

CORN HEAD POLY LINER

INSTALLATION INSTRUCTIONS


1. Layout poly liner, starting at the center section and proceeding to each end.
2. To obtain best results when fastening, drill and rivet from the center to each end. Drill holes oversize in poly to $\frac{1}{4}$ " diameter to allow for expansion.
3. Place lead edge against seam; fasten every 6 inches along the entire width of the panel, roughly $\frac{1}{2}$ " away from the seam.
4. Fasten the center panel's trailing edge as close to the throat opening as possible, spacing rivets every 4 inches.
5. To fasten trailing edge, you have two options:

Option #1:

Rivet trailing edge just below the stripped bar approximately every 8 to 10 inches. (You may have to trim trailing edge to mount below stripper bar.)

Option #2:

Remove stripped bar; place the panels under the bar. Then reinstall stripper bar over trailing edge.

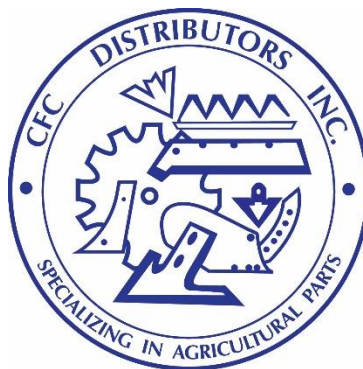

CFC Distributors, Inc.

www.cfcdist.com

800.548.6633